

S&T MOTORS CO., LTD.

-----#77, SUNGSAN-DONG, CHANGWON-CITY, KYUNGNAM, KOREA Tel.82-55-276-7385, Fax.82-55-274-0585-----

ISSUE NO. : 10-010	DATE : May 13th. 2010	PAGES : 1 OF 2
--------------------	-----------------------	----------------

SUBJECT	IMPROVEMENT IN TURN SIGNAL RELAY NOISE
MODEL	GV/GT650(R), ST7
EFFECTIVE F/M NO	-

This service bulletin is written to announce the IMPROVEMENT IN TURN SIGNAL RELAY NOISE


1. Trouble Cause

- The Turn signal relay makes sometimes abnormal noises when ignition key is at "off" position.

2. Improvement in RELAY



< BEFORE-OPEN SYSTEM >




< AFTER-SEALED SYSTEM >

3. APPLICATION

1) APPLICATION LOT

MODEL	PART NO.	DATE	LOT
GV/GT650(R)	38610HL7300	2010.2.5	FBE
GV/GT650(R)	38610HR9700	2010.2.10	FBJ
ST7	38610HR9750	2010.2.10	FBJ

2) Marking on part

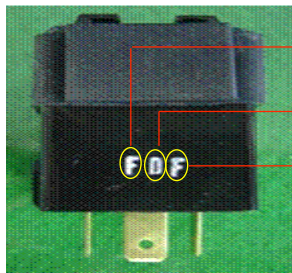

→ YEAR(2009:E, 2010:F, 2011:G)

→ MONTH(Jan:1, Feb:2 ~ Dec:12)

→ DATE(1st:A, 2nd:B ~ 26th:Z, 27th:7 ~ 30th:0, 31st:1)